

COMMONWEALTH OF KENTUCKY
BEFORE THE PUBLIC SERVICE COMMISSION

In the Matter of:

LOUISVILLE GAS AND ELECTRIC COMPANY)	
)	
_____)	CASE NO. 97-174
)	
ALLEGED VIOLATIONS OF ADMINISTRATIVE)	
REGULATION 807 KAR 5:041)	

O R D E R

Louisville Gas and Electric Company ("LG&E"), a Kentucky corporation which engages in the distribution of electricity to the public for compensation for light, heat, power, and other uses, is a utility subject to Commission jurisdiction. KRS 278.010(3)(a) and 278.040(1).

KRS 278.280(2) directs the Commission to prescribe rules and regulations for the performance of services by utilities. Pursuant to this statutory directive, the Commission promulgated Administrative Regulation 807 KAR 5:041, Section 3, which requires electric utilities to maintain their plant and facilities in accordance with the standards of the National Electrical Safety Code (1990 edition) ("NESC").

Commission Staff has submitted to the Commission a Utility Accident Investigation Report dated December 5, 1996, appended hereto, which alleges:

1. At approximately 7:05 p.m. on October 16, 1996, Charles D. Sheard received an electric shock when he came into contact with a tree located at 1020 West Market Street, Louisville, Kentucky.

2. Shortly after Sheard came into contact with the tree, a bystander reported seeing sparks coming from the tree and a burning wire fall from the tree. The Louisville Fire Department was called to the scene. At 7:19 p.m., it advised LG&E of these conditions.

3. The limbs from the tree in question came into contact with the incandescent street lighting circuit located on LG&E Pole No. E2-2468. As a result, electric current from the street lighting circuit was transferred to the tree.

4. On the day of the incident, an LG&E work crew was working on LG&E Pole No. E2-2468 and had knowledge of that pole's conditions.

5. LG&E owns the electric facilities and utility poles involved in the incident.

6. NESC Section 218A1 provides that "[t]rees which may interfere with ungrounded supply conductors should be trimmed or removed."

7. LG&E failed to comply with NESC Section 218A1.

8. As a result of its failure, LG&E is in probable violation of Administrative Regulation 807 KAR 5:041, Section 3.

Based on its review of the Utility Accident Investigation Report and being otherwise sufficiently advised, the Commission finds that prima facie evidence exists that LG&E has failed to comply with Administrative Regulation 807 KAR 5:041, Section 3.

The Commission, on its own motion, HEREBY ORDERS that:

1. LG&E shall appear before the Commission on August 14, 1997 at 10:00 a.m., Eastern Daylight Time, in Hearing Room 2 of the Commission's offices at 677 Comanche Trail, Frankfort, Kentucky, for the purpose of presenting evidence concerning

the alleged violation of Administrative Regulation 807 KAR 5:041, Section 3, and of showing cause why it should not be subject to the penalties prescribed in KRS 278.990(1) for this alleged violation.


2. LG&E shall submit to the Commission within 20 days of the date of this Order a written response to the allegations contained in the Electrical Utility Accident Investigation Report.

3. The Utility Accident Investigation Report of December 6, 1996, a copy of which is appended hereto, is made part of the record of this proceeding.


4. Any motion requesting any informal conference with Commission Staff to consider any matter which would aid in the handling or disposition of this proceeding shall be filed with the Commission no later than 20 days from the date of this Order.

Done at Frankfort, Kentucky, this 24th day of April, 1997.

PUBLIC SERVICE COMMISSION


Chairman


Vice Chairman


Commissioner

ATTEST:


Executive Director

APPENDIX

AN APPENDIX TO AN ORDER OF THE KENTUCKY PUBLIC
SERVICE COMMISSION IN CASE NO. 97-174 DATED 4/24/97

UTILITY ACCIDENT INVESTIGATION REPORT

Utility:	Louisville Gas and Electric Company				
Reported By:	George Siemens				
Dates & Times					
Accident Occurred:	10/16/96 - Approximately 7:05 p.m.				
Utility Notified:	10/17/96 - 12:30 p.m.				
PSC Notified:	10/17/96 - 3:20 p.m.				
Investigated:	10/18/96				
Written Report Rcvd:	10/24/96				
Location of Accident:	1020 West Market Street, Louisville, Kentucky				
Description of Accident:	<p>Mr. Charles D. Sheard touched a tree in front of 1020 West Market Street and apparently received an electric shock. The tree that Mr. Sheard touched was in contact with an incandescent street lighting circuit. The incandescent circuit is controlled by an electric photocell which energized the circuit when darkness occurs. The photocell and the incandescent circuit are attached to pole #E2-2468. Prior to this incident, pole #E2-2468 was in the process of being replaced. A new pole had been set on the east side of pole #E2-2468. To complete this procedure, wires were temporarily displaced from their normal position on the pole.</p>				
Victims:					
Name:	Mr. Charles D. Sheard	Fatal:	No	Age:	37
Addr./Empl.:	4612 West Broadway, Apt #3, Louisville, Kentucky/Tony's Roofing				
Injuries:	Electric Shock				
Sources of Information:	Name	Address/Employment			
	Joe Douthitt	LG&E Investigator, Louisville, Kentucky			
	Mike Leake	LG&E Electrical Engineer, Louisville, Kentucky			
	Doug Blakeman	LG&E Director Electric Service Delivery, Louisville, Kentucky			
	Sonny Campbell	LG&E Distribution Operations Supervisor, Louisville, Kentucky			


Page 2

	Ron Hasch		LG&E Employee Job Coordinator, Louisville, Kentucky		
	John W. Land		PSC Engineering Staff - On-Site Investigation		
	Charles D. Sheard		4612 West Broadway, Louisville, Kentucky		
Probable Violations:	807 KAR 5:041, Section 3 and 1990 NESC, Section 20, Sub. Paragraph 218.A.1, Tree Trimming				
Line Clearances At Point of Accident:	Measured	Minimum Allowed by NESC	Applicable NESC Edition ¹	Volt.	Constr. Date
Three Phase Primary to Ground Elevation: Three Phase Primary to Ground Elevation: Head Guy: Damaged Head Guy: Incandescent Street Light Circuit: Fire Alarm Circuit: CATV Cable: Supervisor Cable: Phone Cable:	42' - 6"	18' - 6"	1990	13000V	1996
	38' - 2"	18' - 6"	1990	4000V	1996
	34' - 2"	15' - 6"	1990	N/A	1996
	33' - 10"	15' - 6"	1990	N/A	1996
	24' - 0"	18' - 6"	1990	240V	1996
	20' - 5"	16' - 6"	1990	120 V	N/A
	19' - 1"	15' - 6"	1990	N/A	N/A
	18' - 7"	15' - 6"	1990	N/A	N/A
	17' - 6"	15' - 6"	1990	N/A	N/A
Date of Measurement:	October 18, 1996				

¹ Current edition adopted by the Commission. If clearances are not in compliance with the current edition, then the edition in effect when the facilities were last constructed or modified would apply.

December 5, 1996

Page 3

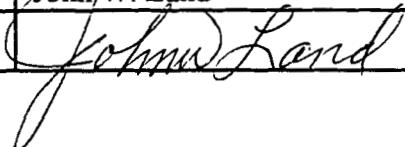Approximate Temp.:	40°
Measurements Made By:	Ron Hasch, Bruce McGuff - LG&E Employees and John W. Land - PSC Engineering Staff
Investigated By:	John W. Land
Signed:	

- Attachments
- A. PSC Accident and Trouble Report
 - B. Louisville Gas and Electric Company's Investigation Report
 - C. Photographs

Attachment A
PSC Accident and Trouble Report

P. S. C.
ACCIDENT AND TROUBLE REPORT FORM

TODAY'S DATE 10-17-96 TIME 3:20 pm

COMPANY LG&E

PERSON REPORTING INCIDENT: NAME: George Siemens

TITLE: _____

ADDRESS: _____

PHONE NO: 502-627-2323

ACCIDENT DESCRIPTION: Man called today - yesterday he was shocked by a tree. Woke up this morning with problem in his arm. (LG&E) LG&E investigated now - looks like a guy wire in a street light circuit. Advised we needed to

VICTIMS NAMES: _____ SEX _____ AGE _____ DEATH _____ INJURY _____

_____ SEX _____ AGE _____ DEATH _____ INJURY _____

_____ SEX _____ AGE _____ DEATH _____ INJURY _____

LOCATION OF ACCIDENT: _____

TIME OF OCCURRENCE: _____

TROUBLE DESCRIPTION: _____

TIME OF OCCURRENCE: _____

TIME OF RESUMPTION OF NORMAL SERVICE: _____

NUMBER OF CUSTOMERS AFFECTED: _____

SIGNED

DATE

M. Nuts

10-17-96

Attachment B

Louisville Gas and Electric Company's Investigation Report

George R. Siemens, Jr.
Director
External Affairs

Louisville Gas and Electric Company
220 West Main Street
P.O. Box 32010
Louisville, Kentucky 40232
502-627-2323
502-627-2930 FAX

October 25, 1996

RECEIVED

OCT 28 1996

DIVISION OF
ENGINEERING & S

Ms. Martha Morton, Manager
Electrical Branch
Kentucky Public Service Commission
730 Schenkel Lane
P.O. Box 615
Frankfort, KY 40602

RE: Alleged Electric Shock -- 1020 West Market Street
Louisville, Kentucky -- October 16, 1996


Dear Ms. Morton:

Attached is the hard copy of the "Investigation Report" faxed to you yesterday on the above incident. Please note that the date of incident on the report has been changed to October 16, which is the date the incident took place even though we were not notified until October 17.

Also attached are drawings made of the scene by Ron Hasch and photographs taken by Joe Douthitt.

If you need additional information, please do not hesitate to contact me.

Sincerely,

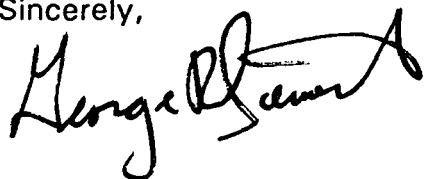

Attachments



Louisville Gas and Electric Company
220 West Main Street
P.O. Box 32010
Louisville, Kentucky 40232

INVESTIGATION REPORT

ALLEGED ELECTRIC SHOCK

Type of Report

96-E-039

Report Number

Joe Douthitt

Investigator

October 16, 1996

Date of Incident

Reference: Alleged Electrical Shock

Location: 1020 West Market
Louisville, KY 40202

Case Summary:

On Thursday, October 17, 1996 at 1230 hours, I received a call from Anthony Highland, Senior Distribution Operations Supervisor. Mr. Highland advised that Sonny Campbell, Distribution Operations Supervisor, was en route to 4612 West Broadway to meet a man who stated he had been shocked when he touched a tree in front of 1020 West Market on the evening of October 16, 1996.

At 1250 hours I arrived at 4612 West Broadway and met with Mr. Campbell and Charles Sheard. Mr. Sheard advised that at approximately 1905 hours the previous evening he parked his car on the street directly on front of the building at 1020 West Market Street. As he and his girlfriend, Tosha Rand, walked from his car, he touched a tree with his right arm and it "jarred" him, but he continued on to his meeting.

Mr. Sheard advised that approximately 10 minutes after he went into the meeting someone in the meeting saw sparks coming from the trees. A short time later a burning wire fell to the ground, and the fire department was called.

Mr. Sheard advised that when he woke up on Thursday morning, October 17, his right shoulder was sore and he was unable to go to work.

Mr. Campbell and I arrived at 1020 West Market at 1315 hours and were met by Ron Hasch, Job Coordinator, and Bruce McGuffin, Line Technician A. Messrs. Hasch and McGuffin made measurements of the lines, pole, and trees at that location.

Incident
October 16, 1996
1020 West Market Street
Louisville, KY 40202
Page 2

The following conditions were noted. A light standard located on the south side of Market Street between poles #E2-2467 and #E2-2512 had a disconnected wire on its west side. This wire is fed by an incandescent lighting circuit "tub" located on pole #E2-2468. This pole was in the process of being replaced and a new pole was set on the east side of it on October 16. Extension arms were attached to pole #E2-2468 to spread the wires (a normal procedure for pole replacement). The lower extension arm held the end of a 240 V secondary line, and a guy wire holding it in place. The other end of the guy was attached to pole #E2-2467 (where two other guy wires also attached from pole #E2-2468). The guy wire in question was removed on the evening of October 16 by Kevin Rhodes, Line Technician-Trouble. LG&E's correction order #827859 states, "Found temporary head guy laying on incandescent circuit and burning on ground. Cleared up okay." (Note: Notation of "temporary" on correction order was an error. Head guy was permanent.)

There are two trees involved in this incident. The larger tree, directly in front of 1020 West Market Street, is the one Mr. Sheard advises he touched, and a smaller tree, which is located just west. The larger tree has limbs which have grown into the incandescent wire. The smaller tree suffered fire damage on the evening of October 16. All that remains of the smaller tree is a burned stump. The fire department removed the rest of the tree on October 16. The concrete on the sidewalk surrounding the stump of the small tree contains several burn marks. According to Mr. Hasch, these are indicative of incandescent circuit voltage.

The incandescent lighting circuit would not have been energized on October 16 until dark when the photocell closed the circuit. It appears the guy wire picked up current directly from the incandescent and transferred the current to the tree.

Photographs were made of the scene.

On Friday, October 18 at 0900 hours, I met with John Land of the Public Service Commission. Mike Leake, Lead Electrical Engineer, accompanied us to the West Market location. Already at the scene were Doug Blakeman, Director Electric Service Delivery, and Messrs. Hasch, Campbell, and McGuffin. Mr. Land requested Mr. Hasch make a few additional measurements to locate the trees on his diagram.


Mr. Campbell requested the Forestry Department send a crew to trim the tree limbs close to the incandescent circuit. This work was completed on October 18.

Incident
October 16, 1996
1020 West Market Street
Louisville, KY 40202
Page 3

While at the scene, Mr. Sheard arrived. He advised that he had been to Jewish Hospital on October 17 and was examined by Dr. Corey Cohen. Dr. Cohen had advised his kidneys and blood are okay, but he could not tell if there was any neurological damage in his arm.

The scene was cleared at 1230 hours. Mr. Land returned to the BOC with Mr. Hasch to determine when the trees were last trimmed and when the last service inspection had been conducted.

<u>Victim:</u>	Charles Sheard	
	4612 West Broadway	SSN: 428-08-3816
	Louisville, KY 40211	DOB: 3/23/69
	Phone: (502) 778-1875	
	Employed by: Tony's Roofing	

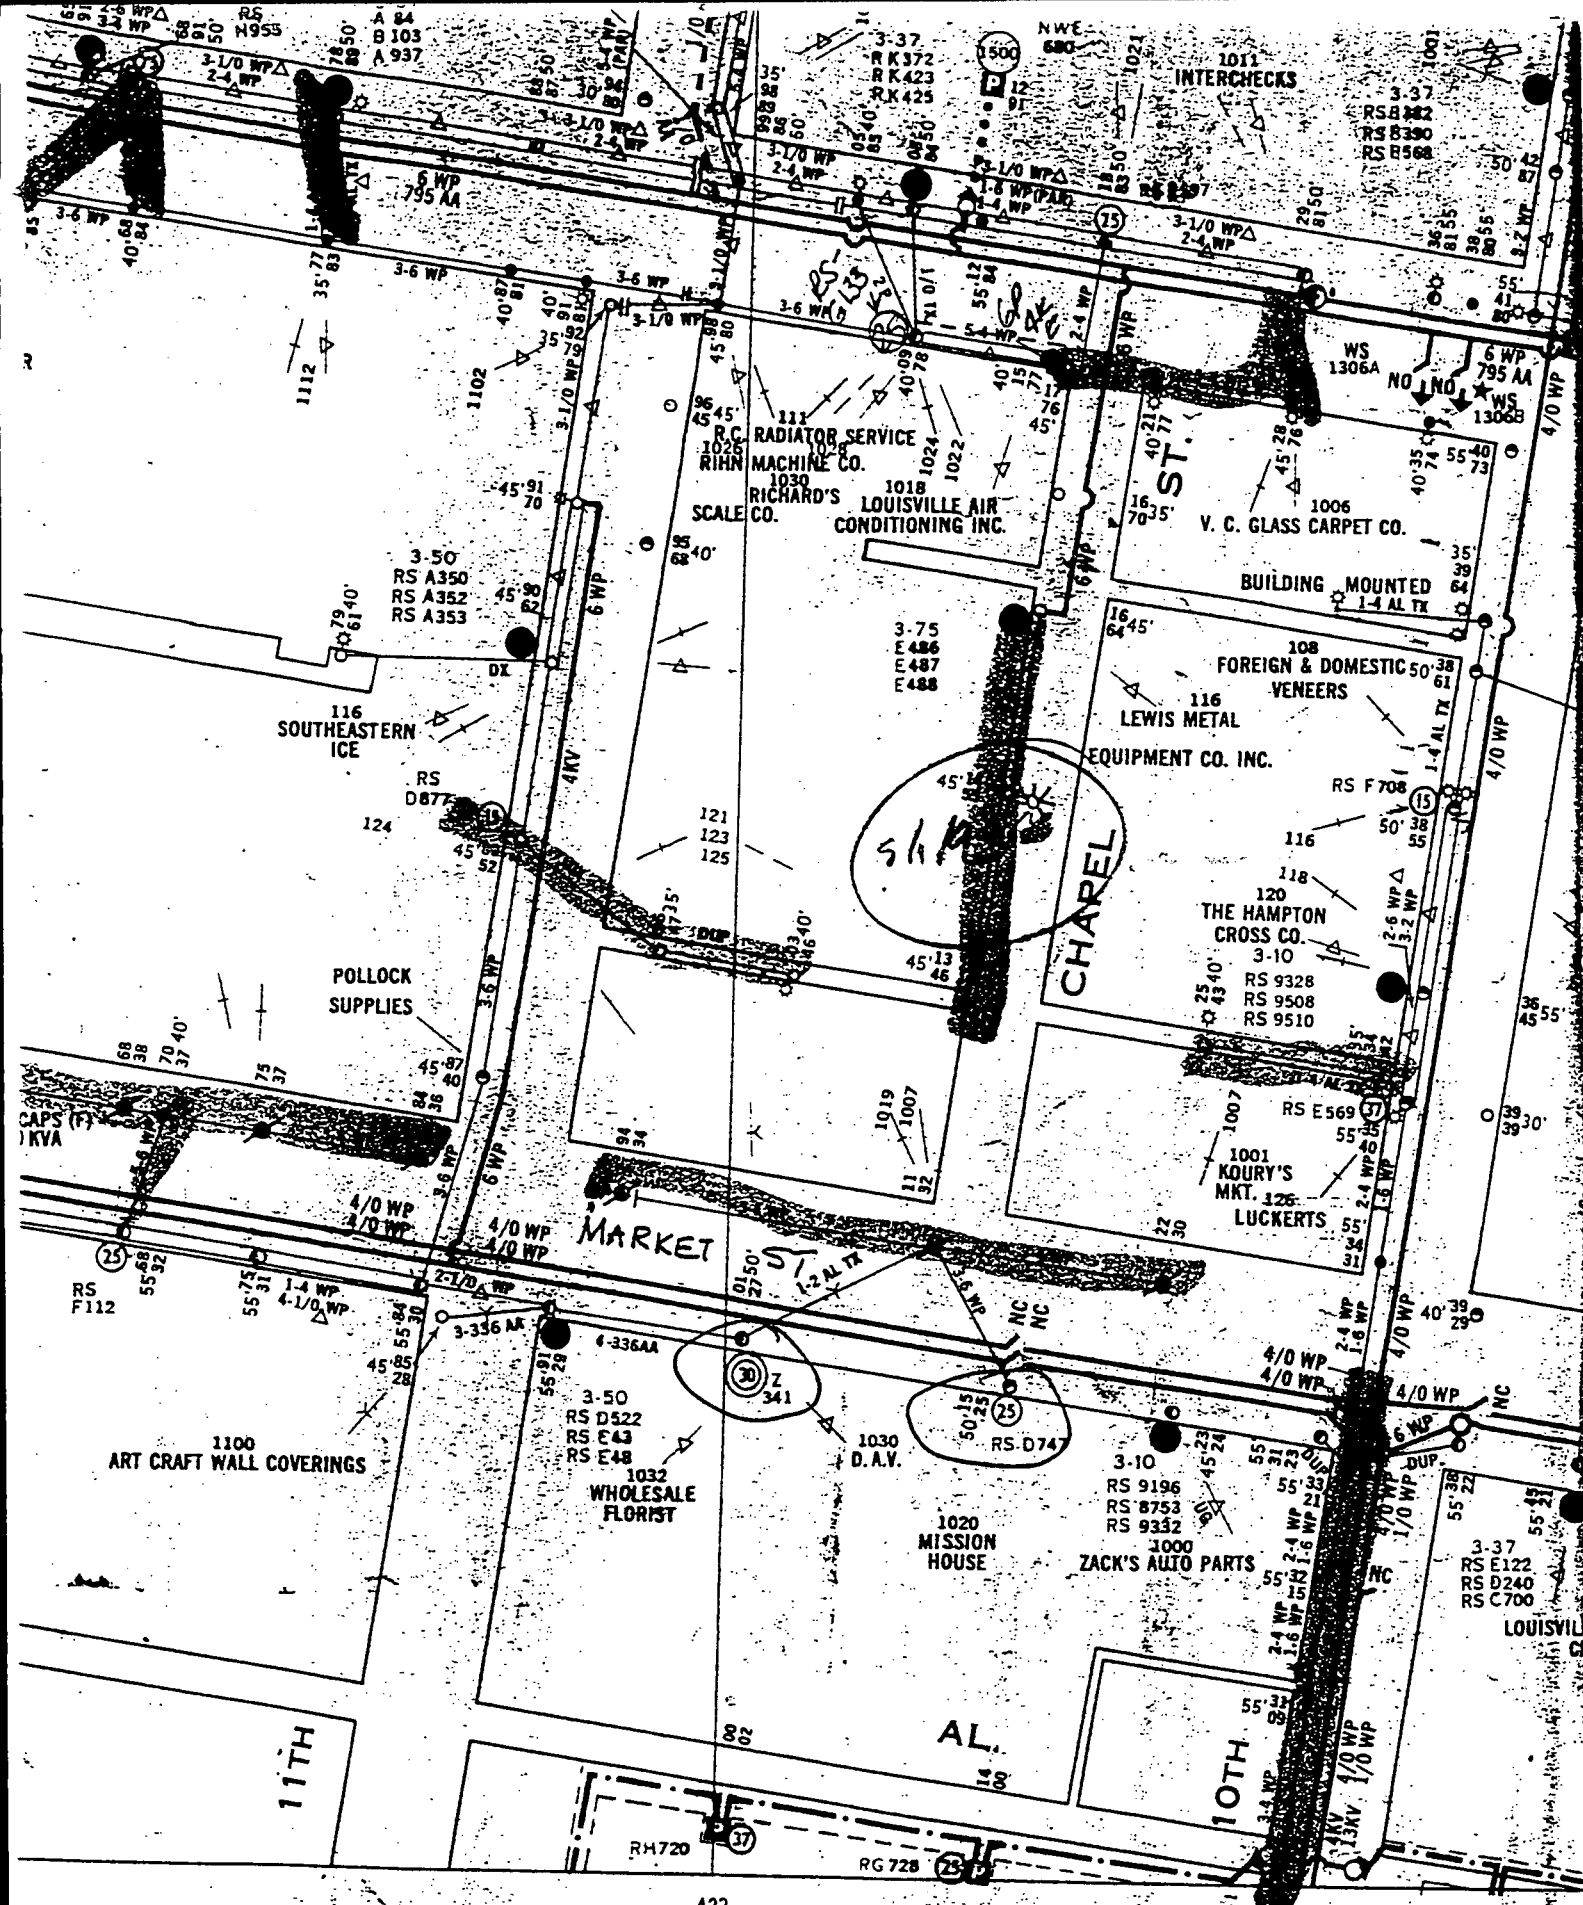

LOUISVILLE GAS AI

0 50 100 200

MAP NUMBER

422-882-1

DOOR HANGER

LANG DATE

LOCATION OR ADDRESSES

FOREMAN:

FIRST DATE TRIMMING BEGAN ON THIS MAP

SIGN AND DATE BELOW WHEN YOUR WORK IS COMPLETE:


SIGNATURE

229

BUCKET FORBID


MANUAL FOREMAN

COMMENTS:

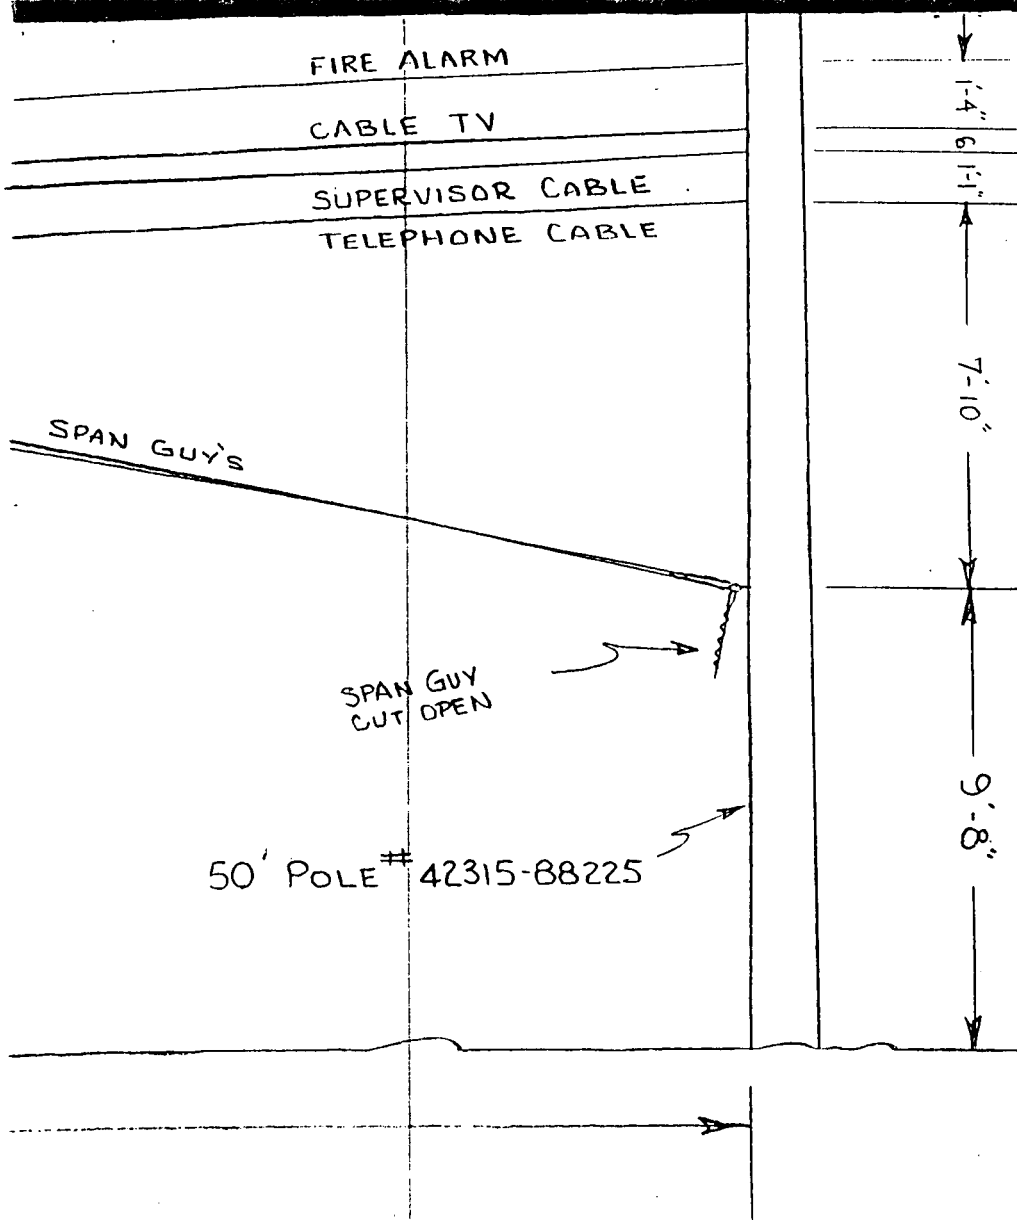

LOUISVILLE GAS & ELECTRIC CO.

SKETCH SHOWING POLE # 42315-88225
 AND POLE # E2-2468 IN FRONT OF
 1020 W. MARKET ST. WHERE ACCIDENT
 OCCURED TO CHARLES SHEARD 10-16-96
 NO SCALE DRAWN BY R.W. HASCH

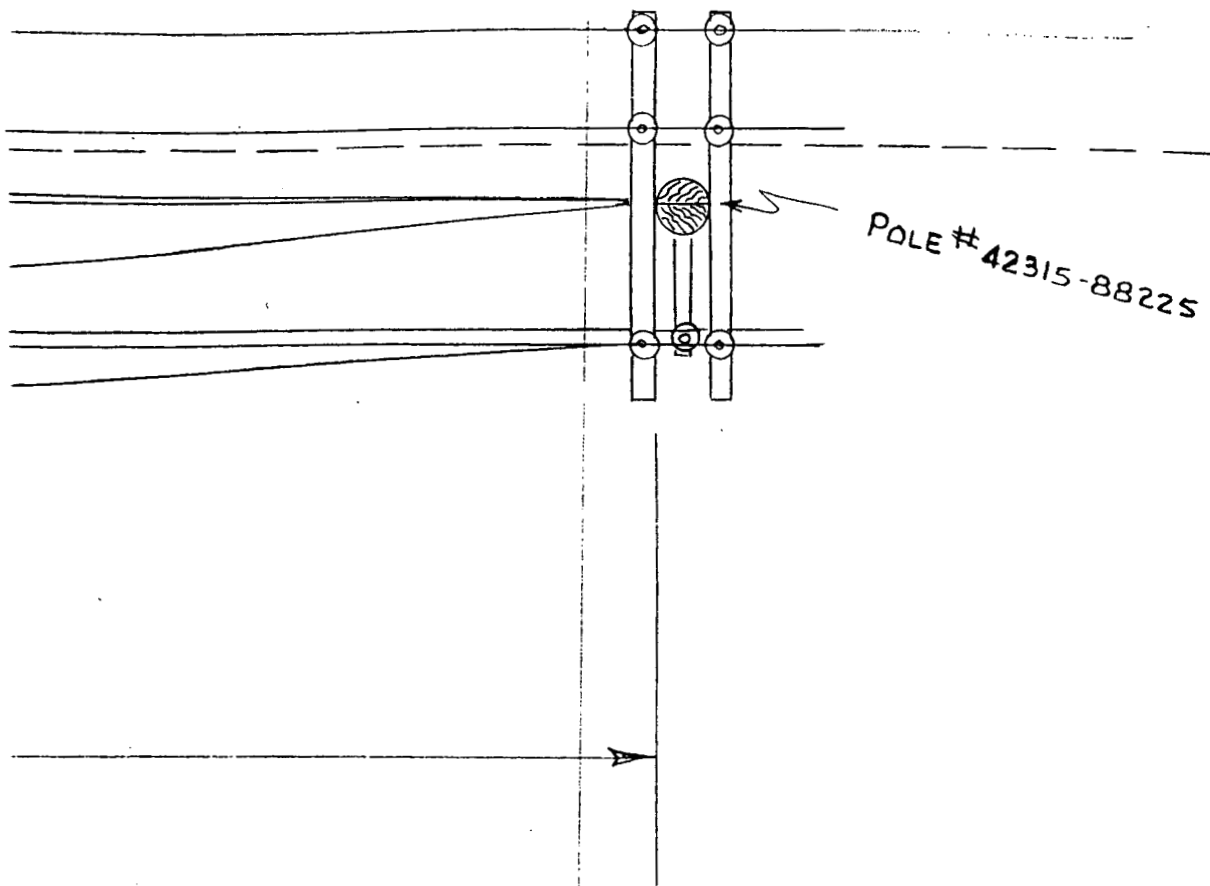

LOUISVILLE GAS & ELECTRIC CO.

SKETCH SHOWING OVERHEAD VIEW OF
POLE #42315-88225 & POLE # E2-2468
AT 1020 W. MARKET WHERE ACCIDENT
OCCURED TO CHARLES SHEARD 10-16-96
NO SCALE DRAWN BY R.W. HASCH



George R. Siemens, Jr.
Director
External Affairs

Louisville Gas and Electric Company
220 West Main Street
P.O. Box 32010
Louisville, Kentucky 40232
502-627-2323
502-627-2930 FAX

October 24, 1996

VIA FAX

Ms. Martha Morton, Manager
Electrical Branch
Kentucky Public Service Commission
730 Schenkel Lane
P.O. Box 615
Frankfort, KY 40602

**RE: Alleged Electric Shock -- 1020 West Market Street
Louisville, Kentucky -- October 17, 1996**

Dear Ms. Morton:

Attached is an "Investigation Report" prepared by Joe Douthitt on the above incident. This is filed in compliance with the seven-day reporting requirement.

Photographs taken at the scene and drawings will be sent via U.S. Mail.

If you need additional information concerning this incident, please let me know.

Sincerely,

Attachment



Louisville Gas and Electric Company
220 West Main Street
P.O. Box 32010
Louisville, Kentucky 40232

INVESTIGATION REPORT

ALLEGED ELECTRIC SHOCK

Type of Report

96-E-039

Report Number

Joe Douthitt

Investigator

October 17, 1996

Date of Incident

Reference:

Alleged Electrical Shock

Location:

1020 West Market
Louisville, KY 40202

Case Summary:

On Thursday, October 17, 1996 at 1230 hours, I received a call from Anthony Highland, Senior Distribution Operations Supervisor. Mr. Highland advised that Sonny Campbell, Distribution Operations Supervisor, was en route to 4612 West Broadway to meet a man who stated he had been shocked when he touched a tree in front of 1020 West Market on the evening of ~~October 16, 1996~~.

At 1250 hours I arrived at 4612 West Broadway and met with Mr. Campbell and Charles Sheard. Mr. Sheard advised that at approximately 1905 hours the previous evening he parked his car on the street directly on front of the building at 1020 West Market Street. As he and his girlfriend, Tosha Rand, walked from his car, he touched a tree with his right arm and it "jarred" him, but he continued on to his meeting.

Mr. Sheard advised that approximately 10 minutes after he went into the meeting someone in the meeting saw sparks coming from the trees. A short time later a burning wire fell to the ground, and the fire department was called.

Mr. Sheard advised that when he woke up on Thursday morning, October 17, his right shoulder was sore and he was unable to go to work.

Mr. Campbell and I arrived at 1020 West Market at 1315 hours and were met by Ron Hasch, Job Coordinator, and Bruce McGuffin, Line Technician A. Messrs. Hasch and McGuffin made measurements of the lines, pole, and trees at that location.

Incident Report
October 17, 1996
1020 West Market Street
Louisville, KY 40202
Page 2

The following conditions were noted. A light standard located on the south side of Market Street between poles #E2-2467 and #E2-2512 had a disconnected wire on its west side. This wire is fed by an incandescent lighting circuit tab located on pole #E2-2468. This pole was in the process of being replaced and a new pole was set on the east side of it on October 16. Extension arms were attached to pole #E2-2468 to spread the wires (a normal procedure for pole replacement). The lower extension arm held the end of a 240 V secondary line, and a guy wire holding it in place. The other end of the guy was attached to pole #E2-2467 (where two other guy wires also attached from pole #E2-2468). The guy wire in question was removed on the evening of October 16 by Kevin Rhodes, Line Technician. LG&E's correction order #827859 states, "Found temporary head guy laying on incandescent circuit and burning on ground. Cleared up okay." (Note: Notation of "temporary" on correction order was an error. Head guy was permanent.)

There are two trees involved in this incident. The larger tree, directly in front of 1020 West Market Street, is the one Mr. Sheard advises he touched, and a smaller tree, which is located just west. The larger tree has limbs which have grown into the incandescent wire. The smaller tree suffered fire damage on the evening of October 16. All that remains of the smaller tree is a burned stump. The fire department removed the rest of the tree on October 16. The concrete on the sidewalk surrounding the stump of the small tree contains several burn marks. According to Mr. Hasch, these are indicative of incandescent circuit voltage.

The incandescent lighting circuit would not have been energized on October 16 until dark when the photocell closed the circuit. It appears the guy wire picked up current directly from the incandescent and transferred the current to the tree.

Photographs were made of the scene.

On Friday, October 18 at 0900 hours, I met with John Land of the Public Service Commission. Mike Leake, Lead Electrical Engineer, accompanied us to the West Market location. Already at the scene were Doug Blakeman, Director Electric Service Delivery, and Messrs. Hasch, Campbell, and McGuffin. Mr. Land requested Mr. Hasch make a few additional measurements to locate the trees on his diagram.

Mr. Campbell requested the Forestry Department send a crew to trim the tree limbs close to the incandescent circuit. This work was completed on October 18.

Incident Report**October 17, 1996****1020 West Market Street****Louisville, KY 40202****Page 3**

While at the scene, Mr. Sheard arrived. He advised that he had been to Jewish Hospital on October 17 and was examined by Dr. Corey Cohen. Dr. Cohen had advised his kidneys and blood are okay, but he could not tell if there was any neurological damage in his arm.

The scene was cleared at 1230 hours. Mr. Land returned to the BOC with Mr. Hasch to determine when the trees were last trimmed and when the last service inspection had been conducted.

Victim:**Charles Sheard****4612 West Broadway****Louisville, KY 40211****Phone: (502) 778-1875****SSN: 428-08-3816****DOB: 3/23/69****Employed by: Tony's Roofing**

George R. Siemens, Jr.
Director
External Affairs

Louisville Gas and Electric Company
220 West Main Street
P.O. Box 32010
Louisville, Kentucky 40232
502-627-2323
502-627-2930 FAX

November 13, 1996

RECEIVED

NOV 14 1996

DIVISION OF UTILITY
ENGINEERING & SERVICES

Ms. Martha Morton, Manager
Electrical Branch
Public Service Commission
P.O. Box 615
Frankfort, KY 40602

RE: **Alleged Electric Shock -- 1020 West Market Street
Louisville, Kentucky -- October 17, 1996**


Dear Ms. Morton:

In response to a request received from John Land after his visit to the above location, I have enclosed the following:

- Correction orders prepared by our Electric Trouble Department relating to the incident.
- Tree trimming report prepared by our Forestry Department which shows the trees involved in this incident.

If you have any questions or need additional information, please let me know.

Sincerely,

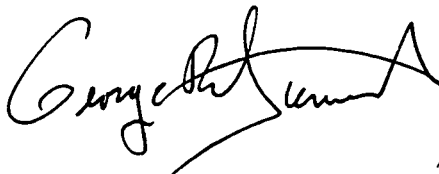

A SUBSIDIARY OF
LG&E ENERGY.

Ctr P10001
 Addr: 1030 W MARKET ST
 Name: FIRE DEPT
 Time: 16-OCT-1996 19:19 Phone
 Tm Tag: Nty Nt2
 To: - Nature Of Complaint --
 Wire Down IN TREES FIRING UP.

Correction Order
 Rec By 2050 Mapsco N o. 827859
 Nt By Grd - T C 3 F 1
 Assigned at 16-OCT-1996 19:35 FKJ
 x PCB -1 Custs 1 WNC Addl 990
 1 N R FMIS MO

Complaint Answered at 16-OCT-1996 19:39 By 3485 Cause
 FOUND TEMPORARY HEAD GUY LAYING ON INCANDESCENT CIRCUIT & BURNING ON GROUND.
 CLEARED UP OKAY. SPECIAL! NEED A CREW TO RE-ENERGIZED CIRCUIT A.S.A.P. **RUSS**

TUB ON OK Corrections Made
 Good Code: Restoration Time: Pcom Aff Custs 1
 Status C Slot 13 PIP CSC Recd
 C.O. Create 16-OCT-1996 19:19 Repair: 16-OCT-1996 20:11 Comp:

CIP P10001
 Address: 1020 W MARKET ST
 Name: LOU F. H.
 Time: 16-OCT-1996 21:04 Phone
 Time Tag: RY SE Mt2 SE Se
 To: - Nature Of Complaint -- NoC...Code 71 N...R FMIS...MO
 Wires Firing Up IN THE TREES

Complaint Answered at 16-OCT-1996 21:41 RY 3485 Cause
 CONDITIONS FOUND
 EOUWD TREES HAD GROWN INTO INCANDESCENT CAUSING IT SPIT OUT SPARKS. AARUSSA

Corrections Made

Good Code: Restoration Time: Pcom Aff Custs 1
 Status C Slot 2 Pip CSC Recd
 C.O. Create 16-OCT-1996 21:04 Repair: 16-OCT-1996 21:56 Comp:

Cir P10001

Correction Order

N O. 827997

Addr: 1030 W MARKET ST

Rec By 3517 Mapsco

T C 3 F 1

Name: SHEPARD CHARLES

Nt By

Grd

FKJ

Time: 17-OCT-1996 12:17 Phone 778-1875

Assigned at 17-OCT-1996 12:58

Addl

Tr: Tag:

Nty SE Ht2 SE SE

X PCB

-1

Custs

1 WNC

1

Shock Complaint

Nature Of Complaint -- Noc Code 19 N R

EMIS MO

PARTY CLAIMED THEY WERE SHOCKED BADLY TOUCHING A TREE AT THIS ADDRESS) PARTY
LIVES AT 4612 W BROADWAY-(CLAIMS DIDN'T WORK DUE TOO PAIN) APT 3

Complaint Answered at 17-OCT-1996 13:31 By 2595

Cause

Conditions Found

CALL SAID LGRE EMP. GOT SHOCKED AT ABOVE ADDRESS. WITH MAN AT ABOVE ADDRESS.
HE DIDNT CALL. LGRE HAS NO WIRES DOWN. KEVIN RHOADES HAD WD CALL HERE ON
10-16-96 IN P.M. SECURITY ARRIVED AND WE MEASURED EVERYTHING AND WORE OUT 2
TAPE MEASURES.

Corrections Made

Good Code:

Restoration Time:


Pcom

Status C Slot 6 Pip CSC Recd

C.O. Create 17-OCT-1996 12:18 Repair: 17-OCT-1996 14:57 Comp:

Aff Custs

1

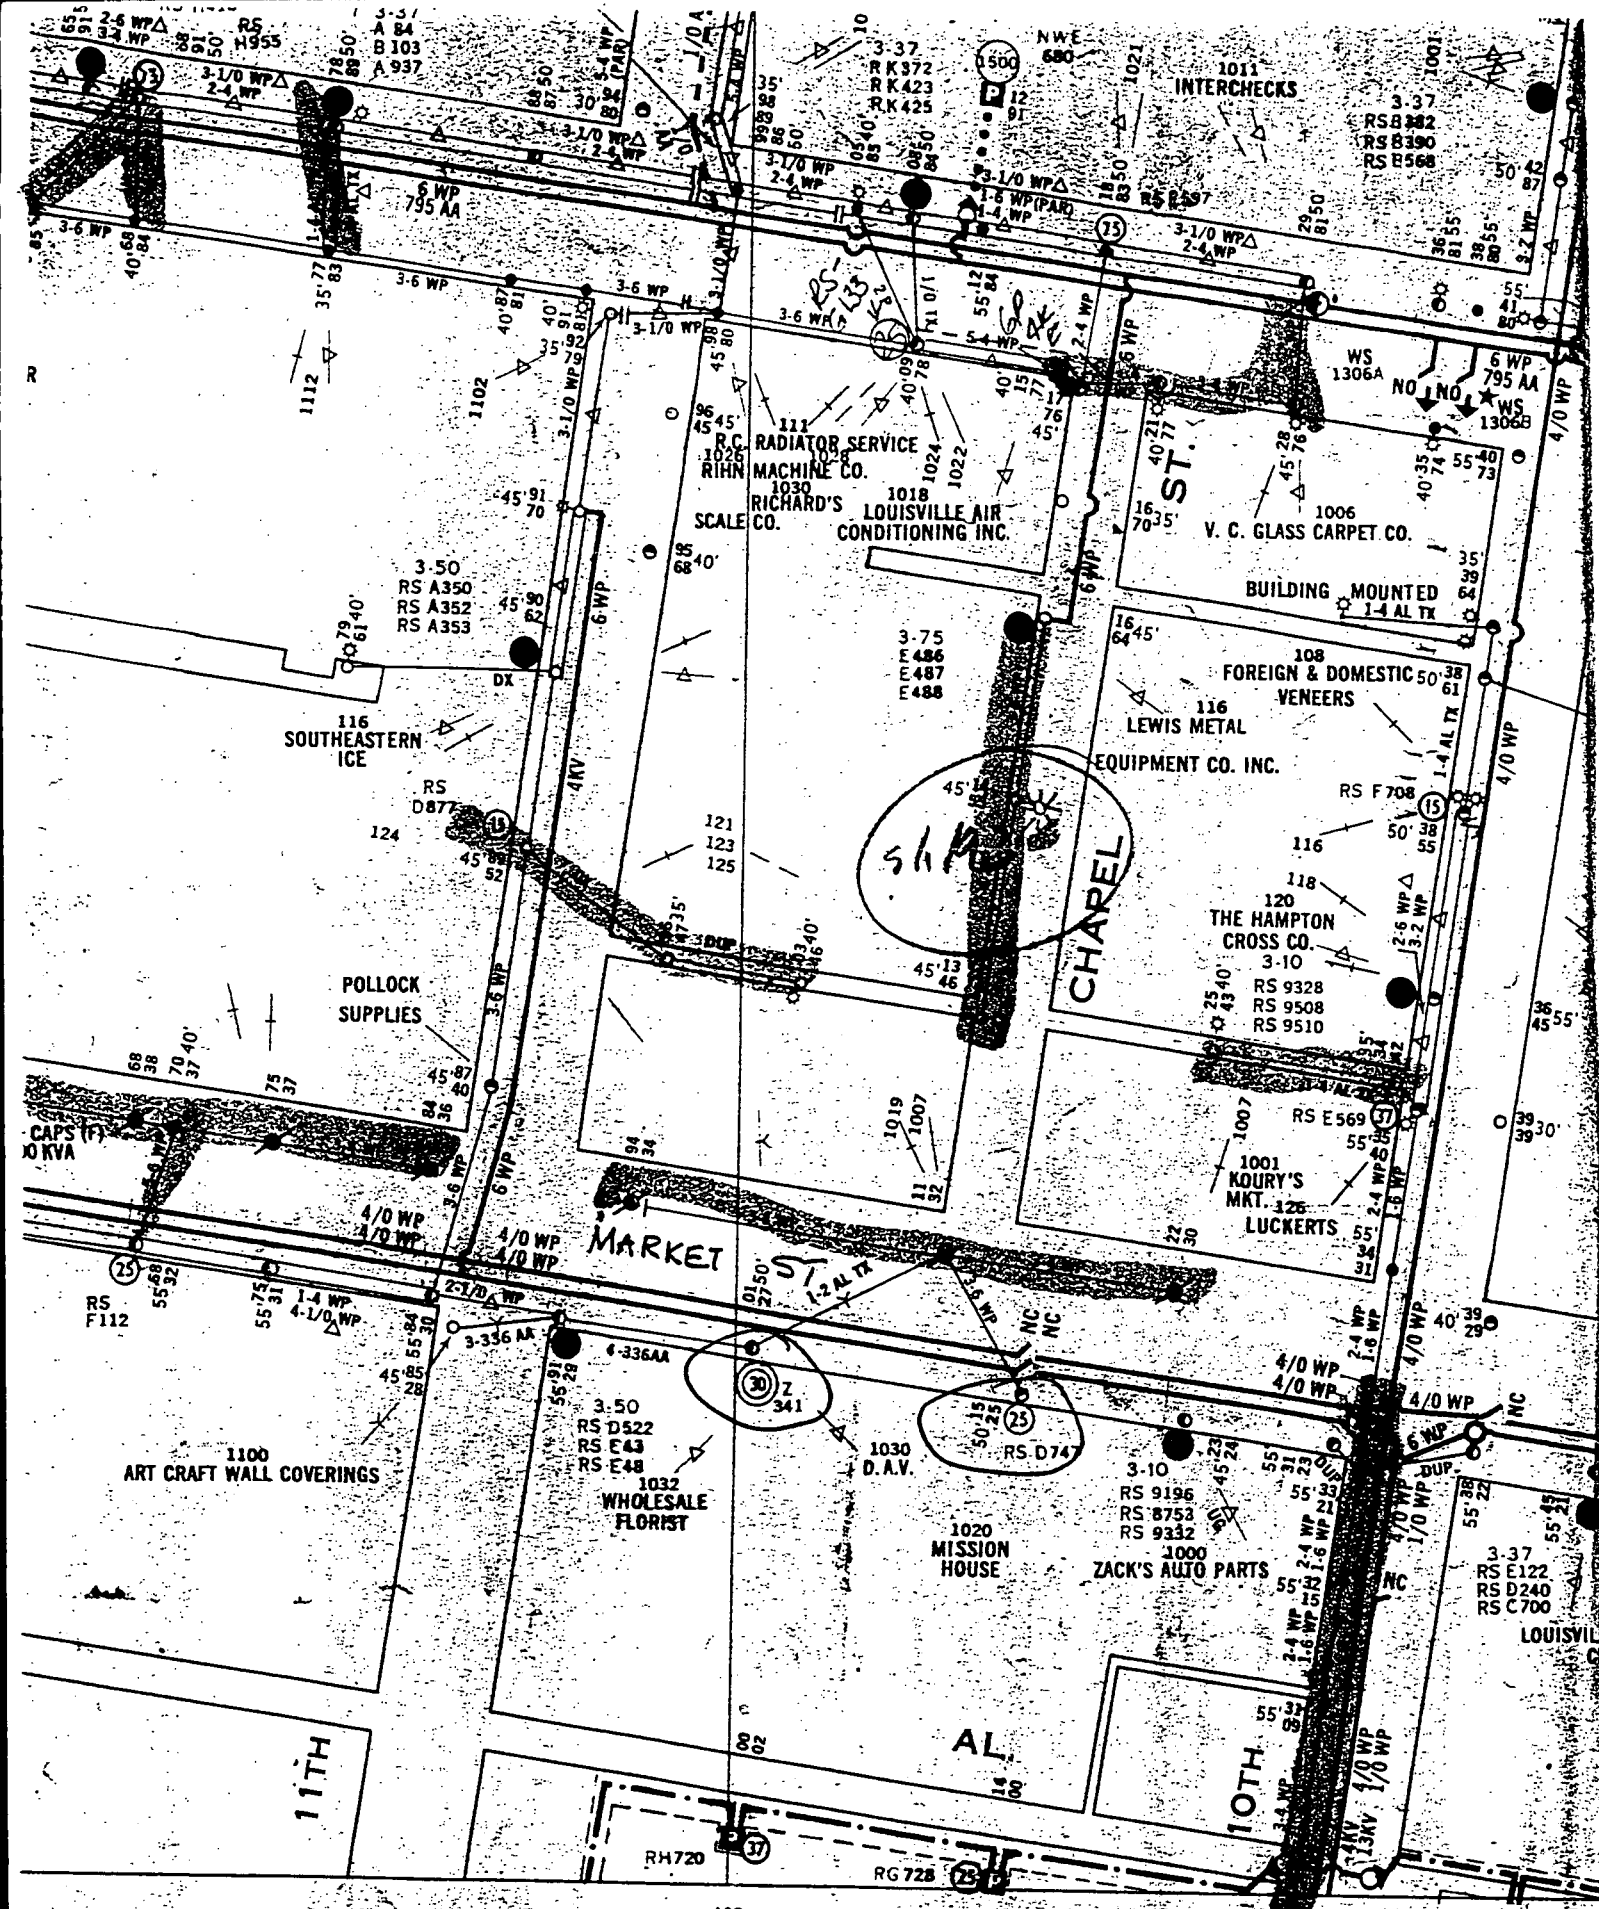

LOUISVILLE GAS AL



MAP NUMBER.

DOOR HANGER

EANG DATE

LOCATION OR ADDRESSES

FOREMAN

FIRST DATE TRIMMING BEGAN ON THIS MAP

SIGN AND DATE BELOW WHEN YOUR WORK IS COMPLETE:

SIGNATURE

2250

BUCKET FORKMAN

MANUAL FOREMAN

COMMENTS:



0 50 100 200

[illegible]

MAP NUMBER.

422-8827

DOOR HANGER

LANG DATE

LOCATION OR ADDRESSES

FOREMAN

FIRST DATE TRIMMING BEGAN ON THIS MAP

SIGN AND DATE BELOW WHEN YOUR WORK IS COMPLETE:


SIGNATURE

232

BUCKET FORSHAN


MANUAL FOREMAN

COMMENTS :

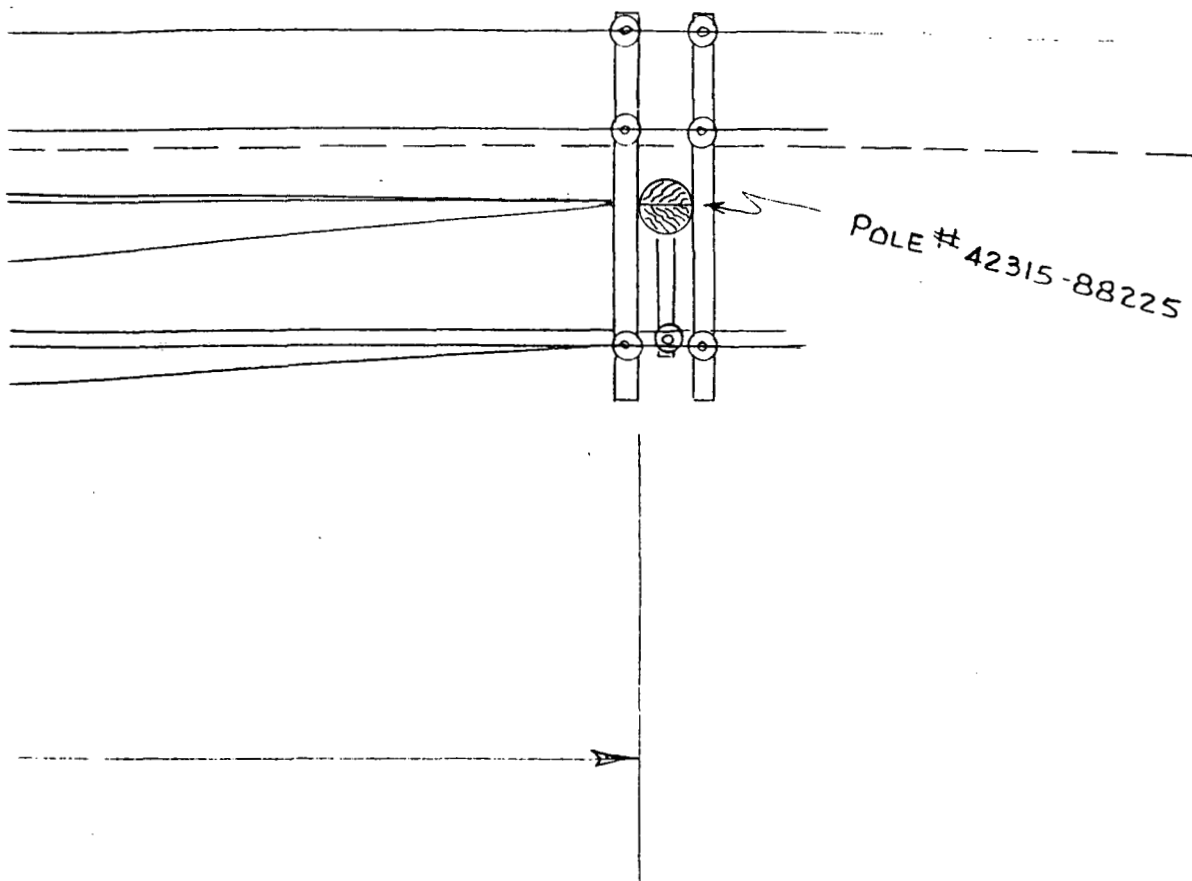

LOUISVILLE GAS & ELECTRIC CO.

SKETCH SHOWING OVERHEAD VIEW OF
POLE # 42315-88225 & POLE # E2-2468
AT 1020 W. MARKET WHERE ACCIDENT
OCCURED TO CHARLES SHEARD 10-16-96
NO SCALE DRAWN BY R.W. HASCH

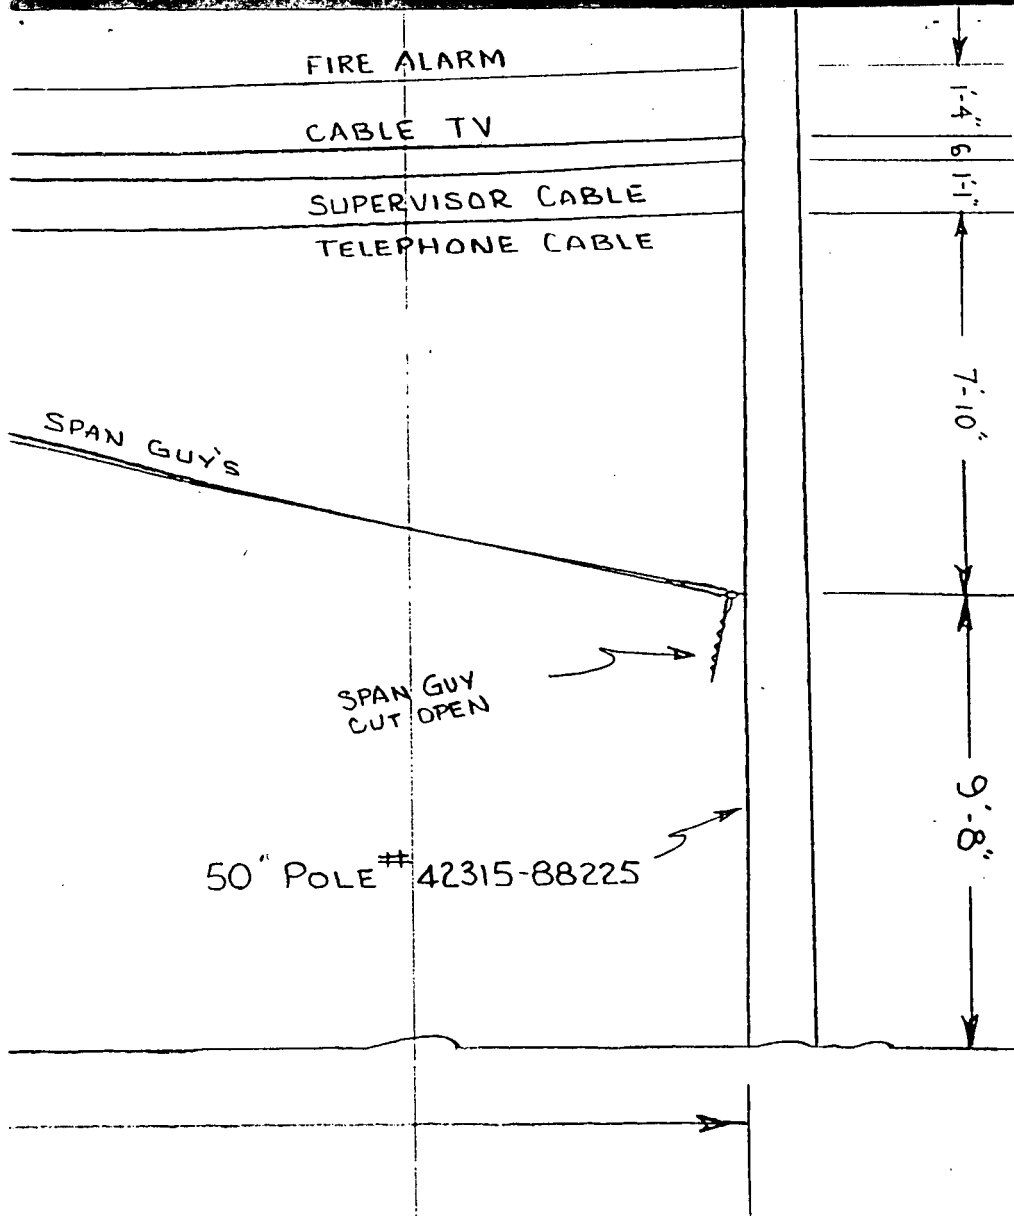

LOUISVILLE GAS & ELECTRIC CO.

SKETCH SHOWING POLE # 42315-88225
AND POLE # E2-2468 IN FRONT OF
1020 W. MARKET ST. WHERE ACCIDENT
OCCURED TO CHARLES SHEARD 10-16-96
NO SCALE DRAWN BY R.W. HASCH

NELSON ST

LEONARD
ABRAHAM
BREELAND
& CO.
643
MELILLO
&
ASSOC
LER-MAR
SALES CO.

ST.

700
THE
SVILLIAN
BLDG.

14
RIFFIN CO. INC.
16

DERBY CAP
NUFACTURING
CO.

ST.
40 WP

40 76 34
UG

7TH

ST.

LOUISVILLE GAS & ELECTRIC CO.
T & D SYSTEM INSPECTION

DATE INSPECTED

8/8/95

INSPECTOR

TK MORGAN

NUMBER OF CORRECTION ORDERS

3

CITY OF LOUISVILLE (19)

N882.000

EC 422-882-1

